


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-174	Smoke	7/20/2009	ADS/TM	S13A_024MH	Dry	Yes	653.99

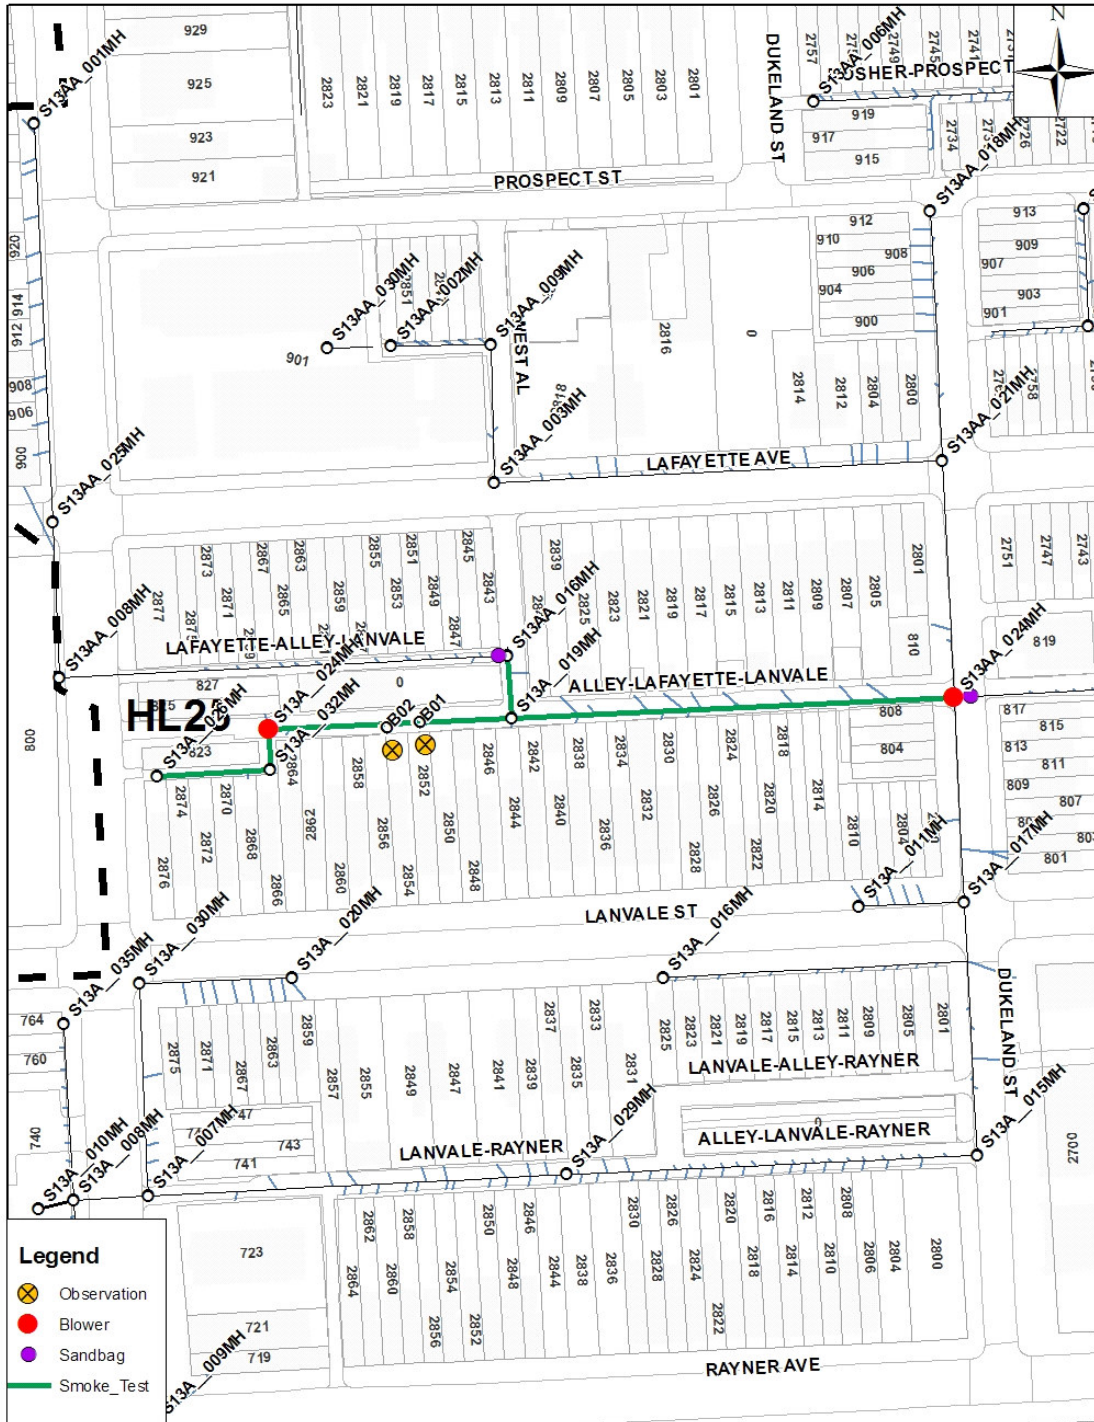

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-174	Smoke	7/20/2009	ADS/TM	S13A__024MH	Dry	Yes	653.99

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S13A__026G1	S13A__026MH	S13A__032MH	82.0005	8
S13A__032G1	S13A__032MH	S13A__024MH	29.3454	8
S13A__024G1	S13A__024MH	S13A__019MH	175.943	8
S13A__019G1	S13A__019MH	S13AA__024MH	320.881	8
S13AA__016G1	S13AA__016MH	S13A__019MH	45.8235	8

Observations & Photos

Obs_ID S1028-174-OB01

Address 2852 Lanvale St.

Status Private

Source Cleanout

Location Yard - back

Nearest MH S13A__024MH

Comments Smoke from below-grade cleanout in back yard. 2852 Lanvale St.



Picture \S1028-174-OB01-P01.jpg

Comments Back of house, 2852 Lanvale St.

Obs_ID S1028-174-OB02

Address 2854 Lanvale St.

Status Private

Source Cleanout

Location Paved concrete

Nearest MH S13A__024MH

Comments Smoke from cleanout in concrete pad of vacant lot. 2854 Lanvale St.



Picture \S1028-174-OB02-P01.jpg

Comments Back of lot, 2854 Lanvale St.